

Dhaka City Water logging Hazards: Area Identification and Vulnerability Assessment through GIS-Remote Sensing Techniques

Rafiul Alam (✉ rafiul.alam@bracu.ac.bd)

BRAC University James P Grant School of Public Health <https://orcid.org/0000-0001-5170-5842>

Zahidul Quayyum

BRAC University James P Grant School of Public Health

Simon Moulds

Imperial College London

Marzuka Ahmad Radia

BRAC University James P Grant School of Public Health

Hasna Hena Sara

BRAC University James P Grant School of Public Health

Md Tanvir Hasan

BRAC University James P Grant School of Public Health

Adrian Butler

Imperial College London

Research Article

Keywords: Water logging, GIS-RS, Slum areas, Built-up areas, Spatio-temporal, Dhaka city

Posted Date: March 22nd, 2021

DOI: <https://doi.org/10.21203/rs.3.rs-345173/v1>

License: © ⓘ This work is licensed under a Creative Commons Attribution 4.0 International License.

[Read Full License](#)

Abstract

Water logging is one of the most detrimental phenomena continuing to burden Dhaka dwellers. This study aims to spatio-temporally identify the water logging hazard zones within Dhaka Metropolitan area and assess the extent of their water logging susceptibility based on informal settlements, built-up areas and demographical characteristics. The study utilizes integrated Geographic Information System (GIS)-Remote sensing (RS) methods, using Normalized Difference Vegetation Water and Moisture Index, distance buffer zone from drainage streams and built-up distributions to identify waterlogged zones with a temporal extent, incorporating social and infrastructural attributes to evaluate water logging effects. All the indicators were integrated into an overlay GIS method to measure the vulnerability level across Dhaka city areas. The findings reveal that south and south-western parts of Dhaka were more susceptible to water logging hazards. Almost 30–40% of Dhaka belongs to the high/very highly vulnerable zone. Greater number of slum households were observed within high to very high water logging vulnerable zones with approximately 70% of poorly structured households. The built-up areas increased around the northern part of Dhaka across time and exposed to severe water logging issues. A holistic and integrated approach is necessary in future development plans to mitigate the risk of water logging.

1. Introduction

Bangladesh is undergoing environmental degradation due to rapid urbanization, increasing population growth, and rapid industrialization (Tawhid 2004). Rapid urbanization is linked with economic development, which has an increasingly higher contribution to the national economy, with almost 36% of the Gross Domestic Product (GDP) coming from the urban economy (Hussain 2013). However, when the growth of the urban population takes place at an exceptionally rapid rate, people and governments face difficulties in keeping pace with the changing situations due to resource constraints and the inability to manage and respond quickly (Bari and Hasan 2001). The country has also been exposed to several types of climate-induced hazards including variations in temperature, excessive and erratic rainfall, water logging and flooding which adversely affect urban life and livelihoods (Rabbani et al. 2011). The situation gets worse when climatic phenomena become tied with non-climatic factors including population density, poverty, rural-urban migration, illiteracy, unplanned urbanization, poor management of natural resources, lack of public utilities and services (Adri 2013).

Dhaka, the capital of Bangladesh, has been ranked top in terms of urban population density (Demographia World Urban Areas 2020). Due to the speedy industrialization and urbanization process, the city is among the top 5 fastest growing megacities in the world (United Nations, 2018) and at the same time a development hub for Bangladesh. However, this development is also bringing in several adverse impacts such as deterioration of environmental quality, increased air and water pollution, and congestion. Dhaka city is also experiencing several socio-economic problems such as rising inequality, poverty, inadequate social security, corruption among others. Water logging, traffic congestion, improper solid waste disposal, black smoke emission from vehicles and industry, air and noise pollution, water pollution from industrial discharge, are also very common problems of the city (Tawhid 2004). In recent

times, water logging has become a main cause for apprehension damaging infrastructures, disrupting daily lives, and demolishing vegetation and aquatic habitats. Several initiatives undertaken by WASA (Water and Sewerage Authority) and the two City Corporations to improve the existing condition have failed due to the absence of proper urban design and planning, landscape architecture and most importantly lack of coordination between project activities and stakeholders (Subrina and Chowdhury 2017).

Urban water logging disaster refers to the phenomenon when a rainstorm or short-time heavy rain surpasses the capacity of the urban drainage system (Xue et al 2016), a very common situation during rainy season in Dhaka. Water logging in Dhaka has become an increasingly predominant burden for the city dwellers and is creating adverse social, physical, economic and environmental consequences by disrupting regular life, causing traffic paralysis, infrastructural damage and destruction of flora and fauna (Subrina and Chowdhury 2017). Urban infrastructures including low-lying houses, schools, colleges, shops, business premises are greatly affected by the water logging problem. People of low-income groups, particularly grocery shop owners, vegetable vendors and day labourers are the main sufferers (Majumder et al. 2018). In addition to the water logging problem, previous studies have shown that almost every year about 60% of Dhaka city becomes submerged due to flooding by the Balu River in the east and the Tongi Khal in the north (Gain et al. 2015). While actions have been taken to ease the growing problem of fluvial flooding and water logging (Papry and Ahmed 2015), these have largely been inadequate. Substantial increase in the impervious area, and improper solid waste management obstructs the natural drainage pattern leading to a shortening of the runoff concentration-time and an increase of the peak flow (Mowla and Islam 2013). Most drains in Dhaka city are clogged by solid waste and plastic waste, due to irregular cleanup, improper management and poor littering and fly-tipping by city dwellers (Anik 2019). Excessive rainfall, disappearance of the natural drainage system, lower capacity of the drainage system are considered the main reasons behind this. Furthermore, unplanned city development, uncontrolled silt load arising from the construction works and major road works involving huge digging during the rainy season further worsen the situation (Tawhid 2004). According to the Bangladesh Institute of Planners (BIP), from 2011 to 2019, minimum 3,483 acres of water bodies and lowlands across the metropolitan area in Dhaka have been loaded up (Nabi 2019). However, the city lacks adequate retention and detention capacity of rainwater and sustainable development of the drainage system during urban planning and design (Mowla and Islam 2013). Many studies have assessed water logging hazards and risks of southwest and southeast coastal zones, at different river basins of Bangladesh (Hassan et al. 2014, Rahman et al. 2009). However, to the best of our knowledge, no studies have evaluated water logging hazards through the lens of GIS and remote sensing integrated approach in the highly urbanized areas of Dhaka.

This study attempts to delineate the surface waterlogged area by analyzing spatio-temporal data of 1990–2019 through establishing a GIS-remote sensing-based spatial model. After identifying the waterlogged hazard areas, the study also aims to assess the vulnerability in those identified water logging hazard zones based on the spatial distribution of built-up areas, slums, dwelling housing types and population density and rank them based on predetermined scales.

2. Materials And Methods

This study was conducted in two steps. First, we utilized different spatial hazard attributes using multi-temporal Landsat and Sentinel satellite imagery. We combined images from 1990, 2010 and 2019 with topographical data including slope, elevation and drainage network to detect the water logging hazard zones. Then we merged the social attributes with spatial data of the hazard zones across Dhaka city to assess the exposure and vulnerability of Dhaka residents to water logging. Our data collection and analysis workflow have been elaborated in Fig. 1.

2.1 Identifying the surface water logging hazard areas

We developed an overlay model to identify the surface water logging hazard zones. An overlay model is a GIS operation that superimposes multiple data points to identify relationships between them. For deploying this model, Normalized Difference Vegetation Index (NDVI), Normalized Difference Water Index (NDWI) and Normalized Difference Moisture Index (NDMI) were analyzed at 20-year and 10-year points from 1990 to 2019 (1990, 2010 and 2019). Topographical data such as slope and elevation, buffer drainage distance were determined by using MERIT Hydro digital elevation data which is a new global flow direction map at 3 arc-second resolution (~ 90 m at the equator) derived from the latest elevation data (MERIT DEM) and water body datasets (G1WBM, GSWO, and OpenStreetMap). The corresponding variables (NDVI, NDWI, NDMI, topographical variation and drainage density, and built-up areas) were initially assigned with equal weight. Then, an overlay was generated by adjusting the rank and weight for mapping the water logging hazard zones.

2.1.1 Normalized Difference Vegetation Index (NDVI)

Normalized Difference Vegetation Index (NDVI) is a globally accepted remote sensing index widely used to detect the vegetation, forest extension and the water bodies over the surface using red and near-infrared light (Jackson and Huete 1991; Sahu 2014; Tucker 1979). An NDVI value always ranges from - 1 to + 1. A value of + 1 indicates dense vegetation, while - 1 implies the presence of extensive deep-water bodies, with 0 signifying the absence of any vegetation. For this study, we followed the methods for segregating vegetated areas from water-logged areas used by Dwivedi and Sreenivas (2002) who measured NDVI value of 0.13 as a threshold using Landsat MSS and TM, and IRS-1A LISS-I data.

2.1.2 Normalized Difference Water Index (NDWI)

The Normalized Difference Water Index (NDWI) examines water content pixels analogous to the way NDVI measures vegetation (Geogr and Gamon 2003; Gao 1996). The values of the NDWI ranges from - 1 to + 1 (McFeeters 1996). According to Chowdary et al (2008), NDWI for waterlogged areas range from 0 to + 1 where + 1 indicates the existence of deep waterbodies with 0 for non-waterbodies. In a previous study, multi-temporal satellite imageries were used to generate the NDWI by using the formula used in the study by McFeeters (1996).

2.1.3 Normalized Difference Moisture Index (NDMI)

NDMI is a modified version of NDWI which is theoretically a similar measure of the previous indices that refers to the spatial variation of surface moisture and wetness (Wilson and Sader 2002). Higher values of NDMI indicate high soil moisture and low values denote low soil moisture content. According to Wilson and Sader (2002) and Goodwin et al (2008) an NDMI of more than + 0.20 indicates moist soil surface with the very good potentiality of groundwater and from + .20 to + 0.10 indicates wet to dry soil with moderate potentiality.

These three indices were analyzed in the GIS environment using raster calculator tools. After downloading the satellite images, all the necessary corrections, band composition, and masking were accurately completed prior to analysis. Radiometric correction was applied including haze and noise reduction with histogram equalization using Erdas Imagine software. Reprojection tool was used to project all images into World Geodetic Survey (WGS) 1984. After that, all the essential seven bands of satellite images were composed into one single image using data management tool. Subsequently, the cells were extracted from the composed image corresponding to the study area using extract by mask tool in GIS environment.

2.1.4 Topographical variation in terms of elevation and slope

Topographical variation was considered as a significant indicator for water logging analysis. Elevation and slope data of 2019 were derived from the MERIT DEM images as topographical variables. Higher altitudes are associated with a lower probability of water logging, while lower altitudes are more susceptible to water logging. A lower topographic slope allows the landscape to retain water and cause water logging, while a steep slope drains quicker.

2.1.5 Drainage buffer distance

The drainage buffer distance was used as a proxy to establish the spatial relation between the drainage network and waterlogged areas. Shape files of lake and large water bodies were collected from the Survey of Bangladesh dataset to determine the area boundary and their extent. Survey of Bangladesh has been providing spatial data of natural features, services and utilities, transport network, distribution of industries etc. After that, a distance tool in spatial analysis was applied. Sahu (2014) conducted a study on mapping of waterlogged areas in Moyna Basin of West Bengal. He found that high density of waterlogged areas is positively correlated with high canal density. Another study found a higher water logging probability for areas close to the canals (Sar et al. 2015). Therefore, the drainage density and their proximity to a particular buffer zone can be considered as potential determinants of waterlogged vulnerable areas.

2.1.6 Changes in built-up areas

The built-up area was measured using Landsat and Sentinel multispectral satellite imageries through unsupervised classification. The unsupervised classification used a grouping algorithm which can automatically determine the frequently repetitive texture patterns to detect built-up areas (Gowthami &

Thilagavathi 2014). The analysis was simplified with two likelihood classes: built-up area pixels and other pixels. The temporal variation of the built-up area shows that its density has been increasing continuously since 1990. In this study, built-up area includes all infrastructure, residential, commercial, mixed-use and industrial areas, villages, settlements, road networks, pavements, and man-made structures. These infrastructures make the surface impervious, both increasing the amount of surface runoff and collecting water in surface depressions. The situation is exacerbated by the lack of effective drainage system in the city.

All the above indicators are considered as input variables to the overlay model. After assigning these variables to equal weights and rank, the overlay analysis was applied to identify the water logging hazard zone.

2.2 Water logging vulnerability assessment with social attributes

For generating vulnerability index, slum distribution, population density, dwelling house types and its floor materials along with changing trend of built-up areas from 1990 to 2019 has been considered. The slum distribution map was generated from slum census 2014 data and BRAC urban slum web portal. The population density map was developed from the global human settlement dataset. Housing characteristics and floor materials data was derived from the Slum census survey 2014 dataset. Built-up areas were extracted from the Landsat and Sentinel satellite imageries. Dot density method was applied to represent the spatial distribution of social attributes over the water logging hazard zones. Categorical values of the social attributes were represented by dots over the identified waterlogged areas to quantify their extent. Each dot represents a particular number of group values and the density of the dots reflected the status of that attribute.

Finally, an integrated spatial model was used to map the water logging hazard and socio-economic risk level using GIS environment over the entire Dhaka city with the aim to provide useful information for better urban planning, management and mitigation of the urban water logging hazard along with its risk factors. For instance, identification of poorly structured households within water logging hazard zones may be prioritized while planning development initiatives. The sources of data that have been used are given below in Table 1.

Table 1
Data sources of the variables used.

Data	Source	Derived information
Digital Elevation model	MERIT Hydro: global hydrography datasets, 2019	Elevation, Slope and contour data, distance from drainage
Multi-temporal satellite images	NASA Earth data and USGS, Sentinel and Landsat temporal satellite imageries (1990, 2010, 2019)	NDWI, NDVI, NDMI
Existing surface water Bodies	Survey of Bangladesh, 2018, 2019	The distance of areas from the existing lake and large water bodies
Population density	Global human settlement, 2018	Population density of different areas in Dhaka city
Slum distribution	BRAC urban slum amp and Slum Census 2014	Slum households' distribution map
Housing types and floor materials	Slum census 2014	Floor materials for dampness and housing types

3. Results

3.1 Water logging hazard attributes

3.1.1 Normalized difference vegetation index (NDVI)

In our present study, NDVI technique on multi-temporal data has been used for the identification of water containing pixels. Figure 2 depicts the NDVI map for 1990, 2010 and 2019. In 1990, the ranges of NDVI was found to be greater than 0.2 which indicates moderate to high vegetation coverage in some areas. On the other hand, in 2010, the NDVI value became lower than 0.2 indicating lower vegetation coverage than 1990. In, 1990, the city had a large number of vegetation coverage which were later covered up by land due to the higher growth rate of population and rapid urbanization. Later in 2019, the vegetation coverage declined sharply and made the city more vulnerable to water logging. The value of NDVI reveals that the city did not have much dense forest cover since 1990, while the NDVI value in 2010 and 1990 represents the agricultural land. In 1990, the city had a large coverage of natural and artificial canals, vegetation compared to other years. Subsequently, in 2010, rapid urbanization took place, which slightly decreased greeneries. This notion also supports the study findings of Rahman et al (2011), where they found Dhaka obtained copious vegetation from the 1989 to 2010 period. However, from the measured values both vegetation coverage, greeneries and water bodies has declined drastically in 2019, as shown in Fig. 2

3.1.2 Normalized Difference Water Index (NDWI)

The NDWI map illustrated in Fig. 3 shows the temporal variation of NDWI value between the years of 1990 to 2019. The highest value of NDWI was observed in 1990 and 2010. In 2019 the highest value of NDWI was observed as 0.12 since urbanization and expansion of built-up areas took place, which was also responsible for lowering water content in 2019. According to Chatterjee et al (2015), the NDWI value ranging from -0.34 to $+0.59$ represents some water logged areas. Nevertheless, in Dhaka city, poor drainage networks and other anthropogenic factors have influenced the value of the index.

3.1.3 Normalized Difference Moisture Index (NDMI)

In NDMI, the high values indicate the existence of more soil moisture under massive water bodies and lower values of NDMI indicate low soil moisture content, as depicted in Fig. 4. It shows the temporal variation of NDMI where the value ranges of NDMI, indicating that the soil in 1990 was highly moist, which has allowed the groundwater to recharge. Besides, in 2010, value ranges of NDMI manifest the soil was comparatively dry, whereas the highest ranges of value around $+0.39$ indicate the soil had higher level of moisture in 2019 than in 2010. In the north and southeastern part of the Dhaka city, the moisture level of soil was high in the sub-urban areas and was low to moderate in the semi urbanized areas. However, the observed soil moisture in the middle part of Dhaka city reflected susceptibility to water logging.

3.1.4 Topographic and slope variation in term of DEM model

Topographic variation is an important factor for the waterlogged situation in flat terrain (Kaiser et al 2013). The elevation map and slope map of the study region have been generated from the Multi-Error-Removed Improved-Terrain (MERIT) DEM satellite data. The highest altitude observed from the analysis is 23 m. The lowest altitude of 0-10m indicates highest waterlogged zones in the study site which lies in the northeastern part of Dhaka city. Besides, the slope of the study area varies from 0.16 degrees to 3.8 degrees (Fig. 5). Areas with high slope and higher altitudes are affected comparatively less by water logging while areas of lower altitude are highly susceptible to the water logging phenomenon.

3.1.5 Distance buffer zone from the drainage stream

In this study, the drainage buffer distance was used to establish the spatial relationship with the existing drainage network. In Fig. 6, the distance from drainage ranges from 0 to 990 meters. Closer proximity of area from a particular stream indicates a lower possibility of water logging as the water runs off to the nearest stream, e.g., lakes and canal, quickly.

3.2 Water logging vulnerable zone and influencing social attributes

3.2.1 Water logging and distribution of built-up areas

Built-up areas have been increasing due to rapid urbanization of Dhaka city. In 1990, the south part of Dhaka city, currently known as Dhaka South City Corporation became more urbanized than other parts of Dhaka. Later in 2010 and 2019, the built-up areas spread over the middle and northern part of the Dhaka city. Figure 7 shows the distribution of built-up areas in the present day. In 2019, larger areas of built-up zones were observed over most of Dhaka city. Therefore, the areas became highly vulnerable to becoming clogged down by water as the drainage network has not improved proportionately. On the contrary, the eastern part of the city, much of it brought within the jurisdiction of the greater Dhaka, is yet to develop and similar levels of built-up areas cannot be observed compared to the other areas.

3.2.2 Water logging and Population density map

The extent of calamities associated with water logging will depend on the population density of the affected area. The population density map reflects the population densification in a particular area and its association with water logging. Figure 8 shows the water logging vulnerability zone and population density. In this figure, vulnerability zones are segmented in 5 different layers as very low, low, medium, high, very high and these zones are associated with the existing population density. It was found that water logging vulnerability was very high in the wards having high population density. On the other hand, areas with medium to high water logging vulnerability also had high population density. In this map, medium vulnerable areas were found in Cantonment restricted area, Badda union and some wards that had a decent population density. The map also shows that Hariramp union, Uttar khan union, Dakshinkhan union, Bhatara union, Dakshingaon union, Manda union, Matuail union, Sarail union, Shyampur union, Sultanganj union and ward 8, 9, 33 were low water logging vulnerable areas and Dumni union, Beraid union, Satarkul union, Nasirabad union and Demra union were very low water logging vulnerable areas with very small population density. In general, more areas with high population density are found to have a higher risk of water logging, the notable exception being the eastern and north-western part of the city which are mainly suburban areas surrounded by wetlands and rivers.

3.2.3 Water logging and Slum household distribution

Slum population are one of the most vulnerable communities in the city living in informal settlements with poor living conditions. Their susceptibility level regarding water logging hazards are clearly depicted in the final generated map. Figure 9 depicts the dot density map of the slum households according to the Slum Census 2014 where 1 dot represents 50 households. The severity of water logging is high among the slum households because of the higher population density in slum areas, unplanned and unhygienic housing and sanitation systems, with very poor access roads and poor environment etc. The map below showing the water logging vulnerability zone and slum household distribution depicts how many slum households are vulnerable to the problems of water logging. The vulnerability of water logging was very high among the wards with the existence of slum households. Also, the existence of slum households was common among the areas of high susceptibility of water logging such as wards (2, 5, 14, 7), which reveals that most of the slum households of Dhaka city are facing serious water logging problem.

3.2.4 Water logging and housing types of the dwellers

Among the housing types of the dwellers in Dhaka city, good housing (Pacca and Semi pacca) and poor housing condition (Jhupri and Kacca) have been categorized from the Slum Census 2014. The consequences and severity of the problem of water logging vary based on the housing types, making it necessary to consider housing types and associate that with water logging. Figure 10 depicts the housing types in the water logging vulnerable zones. It was found that water logging susceptibility was very high within the wards with good housing (Pacca and Semi Pacca). Within same wards, the vulnerability of water logging was also very high in the households with poor housing structures. The water logging susceptibility was very high among other wards with poor housing as well. Lastly, the following analysis implies that almost 70% of poorly structured households lies within high to very high water logging vulnerable zone.

3.2.5 Water logging and associated floor materials

A study on water logging conducted in the 4 urban areas (Sylhet, Dhaka, Mymensingh and Chittagong) in Bangladesh found that 69% of houses in those areas became damaged due to water logging (Anisha & Hossain 2014). That signifies that a poor housing structure in a water logging vulnerable zone will be more prone to experience adverse consequences, especially if floor materials of houses are made from poor construction materials. It can be assumed that water logging causes dampness in some floor materials, making it remain wet for a long period (Gazi and Hossain 2019) and the issues of slipperiness or wetness occurred in the houses with mud floors. Figure 11 shows the water logging vulnerability zones and the poor and good flooring status in those areas. Bamboo and mud types floor were considered as poor floor and the floor made of brick type materials belonged to good flooring condition. The existence of a huge number of houses with poor flooring was found in north and north-western part of Dhaka where the severity of water logging is also very high. A huge number of houses with good floor materials were found throughout Dhaka city, especially in ward 11, 12, 13, where the vulnerability of water logging is also very high. As Dhaka is an urbanized city, most houses are made of brick; mud and bamboo made floor was found in the peripheral areas of north, north-western part and also in some slum areas in the middle part of Dhaka city where water logging vulnerability was also very high.

4. Discussion

This study delineated the water logging vulnerable zone in a comprehensive way depicting the variables and indicators using an overlay weighted technique. The inclusion of temporal extension and social attributes made the research encompassing and exceptional. The method used, the inclusion and integration of spatial, social and demographic data for addressing water logging problem, make it unique and will have significant contribution to advance scientific knowledge.

Moniruzzaman (2012), Tareq et al (2018) and Awal (2014) conducted several studies on water logging in the south-west coastal region of Bangladesh. Severe flood, frequent cyclone events, tidal river mismanagement and excessive rainfall were mentioned as reasons for water logging hazard. Climatic phenomena were considered an important factor of coastal water logging. Amongst the studies, Tareq et

al (2018) conducted his study using geo-informatics and qualitative methods where he suggested to re-excavate the silted riverbed to solve the situation. The methodological framework and conceptualization of this study were similar but the locational characteristics and geomorphological attributes were quite different as Dhaka is a highly urbanized city and the capital of Bangladesh.

Since Dhaka has been undergoing a rapid unplanned urban development in the last two decades. As a result, the city has exceeded its carrying capacity due to extensive urban migration and along with untenable development resulting in several hazards. The development plan has not been implemented in a holistic and integrated way. Moreover, there is no integration within the different institutions of the interconnected neighborhood domains while deploying the interventions. WASA and the two City Corporations have mostly implemented their development projects individually without coordination. Also, the economic gap between rich and poor has been noticeably increasing, with the floating and informal population being deprived of the basic amenities.; hence, the higher population density neighborhood areas always suffer from water logging hazards. Furthermore, 70 to 75% informal settlements are observed in the high to very high water logging vulnerable zone. This scenario demarcates that informal settlements are less prioritized while initiating a development plan. Also, almost 70% of poorly structured houses are found in high to very high water logging susceptible zone. These household members are the worst sufferers of the water logging hazard due to problems arising from floor dampness. The growing expansion of built-up areas has not been properly planned resulting in submersion of these areas during heavy rainfall.

Thiele-Eich et al (2015) analyzed a trend of water level and flooding in Dhaka for the past 100 years and their findings suggested that minimum surface water levels have decreased by 0.71 m to 0.61 m. While the magnitude and duration of the flood have reduced, the frequency of extreme flood events has increased in Bangladesh. Nevertheless, the study could not conclusively show a direct link with rise in mortality or higher morbidity rate due to extreme flood, but the relative risk of death was found to reduce with the decrease in water levels (Thiele-Eich et al. 2015). Inadequate draining capacity and inappropriate lining of pipes were considered as the main cause of long-lasting floods in Dhaka (Pirumanekul and Mark 2001). The geo-referenced model and simulation found that water levels in the street mainly cause urban flooding. The flood simulation model also implied that Shantinagar crossing had the highest inundation (55 cm/6 hours) in 1997 and then Kakrail, Topkhana areas had the flood depth of (19 cm/6 hours) and (25 cm/12 hours) respectively. Dewan et al (2004) delineated the flood extent map in Dhaka city using DEM, where 1988 and 1998 floods were also taken into consideration. During the 1988 flood, almost all the areas were inundated. However, owing to the construction of several embankments, areas in Dhaka city remain flood-free from river water but the rainfall-induced flooding has been very severe.

Dewan et al (2007) illustrated a hazard map that shows that a major portion of Dhaka city was located within a moderate to very high hazard vulnerable zone, especially the suburb areas which have become urbanized in 2010. Masood and Takeuchi (2012) found in their study that about 60 percent of eastern Dhaka regularly submerged in water every year in monsoon due to absence of flood embankment. Due to a lack of proper drainage system, water became clogged down for several hours. Our study findings also

supports this outcome. Besides, Rashid et al (2007) conducted a research on slum dwellers of Mirpur and Vasantek neighborhood areas. The study found that the respondents from Vasantek experienced flooding inside their homes more often and the inundation depth was higher in Vasantek areas than Mirpur areas. It also revealed that all slum dwellers were being exposed to mosquito-borne diseases due to the long-lasting floodwater.

In the urban context, Datta et al (2017) stated that traffic congestion and water logging are the worst problems in Dhaka city. The study found a significant loss of natural water bodies across the city. They suggested forming a “blue network” within the city to solve the transportation and water logging problem. Besides, Subrina and Chowdhury (2018) conducted a study in Dhaka city to identify the causations and evaluate its impact based on internet open-source data and information. Population growth, unplanned development, the disappearance of natural drainage systems and green spaces, topography, waste management and drainage capacity were identified as the major reasons for water logging. The findings of this study which were derived by utilizing open-source data were quite analogous to Subrina and Chowdhury’s study in the Dhaka context. The study recommended macro-scale solutions, including retrieval of canal networking and developing urban fringe areas. Lastly, the poor drainage network, dumping of waste everywhere resulting in the hindrance of water flow as well as clogging down the existing drainage channels. Additionally, absence of sufficient canals and reservoirs to hold extra water, pollution of surrounding rivers etc. were identified as the main reasons behind worsening the water logging situation.

While the present study was able to identify and evaluate the water logging hazard in a highly urbanized area and analyze the risk by overlapping the infrastructure and demographic attributes through the lens of the GIS-RS approach in a temporal extent, a huge strength, it had some limitations too. The main limitation of the study was the unavailability of high resolution satellite images. Also, we could not utilize the high-resolution DEM data. It could have more accurate if we used the high-resolution intra-annual satellite imageries. Updated socio-demographical dataset was also not available for use. Inadequately published literature and lack of data were considered as the major drawback, which would have further enriched the study. Furthermore, it was not possible to acquire the groundwater and flooding data for the study because of its unavailability in a large capacity.

5. Conclusion

The present research demarcated the water logging hazard zones in Dhaka city through integrated GIS-remote sensing method and evaluated the spatial distribution of slum, population density housing types and floor materials associated with the vulnerability level of water logging hazard zone. The results of the study suggest that the south and south-western part of the Dhaka city are comparatively susceptible to water logging hazards as these areas lie on highly to very highly vulnerable zones. Besides, the maps indicate that population density is higher in the waterlogged zones than in the non-water logged zones. Moreover, the slums were densified in the “very high” waterlogged areas. The waterlogged hazard and the vulnerability maps may possibly be used by planners, policymakers and local people for urban

development, water resources management, drainage network development, infrastructure expansion and housing management, etc. An inclusive and integrated approach needs to be included in the future development plans of all sectors to make it sustainable. It is also essential to give extra attention to the lower elevated areas. Informal settlement areas should also be specially focused while initiating an intervention. A proper drainage system needs to be established and the existing canals should also be well maintained and re-excavated regularly to enhance the retention capacity. The identified water logging hazard zones will also be useful for designing future projects in the urban neighborhood context and planning for an healthy city. The applied integrated GIS and Remote sensing method can also be efficiently used for sustainable water resource management purposes.

Declarations

Acknowledgment

The authors would like to acknowledge Shahriar Hasan and Priyanka Sultana Hema, who contributed to the data extraction and compiling open-source internet data.

Conflict of interests

The authors declare that they do not have any conflict of interest.

Author contributions

ZQ initiated and contributed to the preliminary concept and idea of the study. RA developed the methodological framework and design of the study under the supervision of ZQ and MTH, with essential critical feedback of SM. RA conducted the spatial analysis and interpreted the results and drafted the initial version of the manuscript. MAR and HHS revised it critically and gave essential input. ZQ, SM and APB reviewed the revised manuscript critically and gave essential intellectual feedback. Finally, all the authors approved this final version and agreed to be accountable for any kind of questions related to the accuracy or integrity of any part of the work that has been investigated and resolved.

Ethical approval

This study did not require ethical approval as this was based on secondary data. However, this study has been conducted under the project “Pathways to Equitable Healthy Cities” which has received ethical approval from the Institutional Review Board (IRB) of BRAC James P Grant School of Public Health (Protocol No: 2019-012-IR), BRAC University.

Funding

This research was supported by the Pathways to Equitable Healthy Cities grant from the Wellcome Trust [209376/Z/17/Z]. We would like to express our thanks and gratitude to the support and funding provided by the Wellcome Trust foundation through the Pathways to Equitable Healthy Cities (Pathways) project.

References

- Adri, N. (2013). Climate-induced Rural-Urban Migration in Bangladesh: Experience of Migrants in Dhaka City.
- Anik, SAB., *The never ending woe of water logging in Dhaka*. Dhaka Tribune. Viewed 13 July, 2019.
- Anisha, N. F., & Hossain, S. (2014, December). A case study on water logging problems in an urban area of Bangladesh and probable analytical solutions. In *2nd International Conference on Advances in Civil Engineering* (Vol. 26, p. 28).
- Awal, M. A. (2014). Water logging in southwestern coastal region of Bangladesh: local adaptation and policy options. *Science Postprint*, 1(1), e00038.
- Bari, F.M., and Hasan, M. 2001. *Effect of Urbanisation on Storm Runoff Characteristics of Dhaka City*. Tsinghua University Press. XXIX IAHR Congress. Beijing.
- Chatterjee C, Kumar R, Chakravorthy B, Lohani AK & Kumar S (2005) Integrating remote sensing and GIS techniques with groundwa-ter flow modeling for assessment of waterlogged areas. *Water Re-source Management* 19, 539–554. DOI: 10.1007/s11269-005-2071-4.
- Chowdary VM, Chandran RV, Neeti N, Bothale RV, Srivastava YK, Ingle P, Singh R (2008) Assessment of surface and sub-surface waterlogged areas in irrigation command areas of Bihar state using remote sensing and GIS. *Agric Water Manag* 95(7):754–766.
- Datta, U., & Mandal, D. (2017). CREATING BLUE NETWORK: A SOLUTION OF PRESENT WATER LOGGING AND TRANSPORTATION PROBLEM FOR THE DHAKA METROPOLITAN AREA. *Design that cares-inter disciplinary approach to making built environments efficient and meaningful*.
- Demographia World Urban Areas. 16th Annual Edition, June, 2020
- Dewan, A. M., Nishigaki, M., & Komatsu, M. (2004). DEM based flood extent delineation in Dhaka City, Bangladesh. *International Journal of Remote Sensing*, 9(1), 99-110.
- Dewan, A. M., Islam, M. M., Kumamoto, T., & Nishigaki, M. (2007). Evaluating flood hazard for land-use planning in Greater Dhaka of Bangladesh using remote sensing and GIS techniques. *Water resources management*, 21(9), 1601-1612
- Dwivedi R.S. & Sreeniwas K. (2002) The Vegetation and Water logging Dynamics as Derived from Spaceborne Multispectral and Multitempo-ral Data. *International Journal of Remote Sensing* 21(3), 519-531.
- Gain, A. K., Mojtahed, V., Biscaro, C., Balbi, S., & Giupponi, C. (2015). An integrated approach of flood risk assessment in the eastern part of Dhaka City. *Natural Hazards*, 79(3), 1499-1530.

- Gao BC (1996) NDWI—a normalized difference water index for remote sensing of vegetation liquid water from space. *Remote Sens Environ* 58(3):257–266.
- Gazi, M., & Hossain, A. (2019). *Impact of water logging in south western coastal zone of Bangladesh: A case study* (Doctoral dissertation, Khulna University of Engineering & Technology (KUET), Khulna, Bangladesh).
- Geogr J Sims DA, Gamon JA (2003) Estimation of vegetation water content and photosynthetic tissue area from spectral reflectance: a comparison of indices based on liquid water and chlorophyll absorption. *Remote Sens Environ* 84:526–537.
- Goodwin NR, Coops NC, Wulder MA, Gillanders S, Schroeder TA & Nelson T (2008) Estimation of insect dynamics using a temporal sequence of Landsat data. *Remote Sensing of Environment* 112, 3680-3689.
- Gowthami, K., & Thilagavathi, K. (2014, February). Built-up area detection of remote sensing images using static clustering technique. In 2014 International Conference on Electronics and Communication Systems (ICECS) (pp. 1-5). IEEE.
- Hassan, M. S., & Mahmud-ul-islam, S. (2014). Detection of water logging areas based on passive remote sensing data in Jessore District of Khulna Division, Bangladesh. *International Journal of Scientific and Research Publications (IJSRP)*, 4, 12.
- Hussain, Z. (2013). In Bangladesh, the alternative to urbanization is urbanization. *End Poverty in South Asia blog*.
- Jackson RD, Huete AR (1991) Interpreting vegetation indices. *Prevent Vet Med* 11(3):185–200
- Kaiser MF, El Rayes A, Ghodeif K, Geriesh B (2013) GIS data integration to manage water logging problem on the eastern Nile delta of Egypt
- Majumder, A. K., Hossain, M. S., & Al Nayeem, A. (2018). Assessment of people's perception on water logging in Chittagong City Corporation Area, Bangladesh. *Assessment*, 5(2).
- Masood, M., & Takeuchi, K. (2012). Assessment of flood hazard, vulnerability and risk of mid-eastern Dhaka using DEM and 1D hydrodynamic model. *Natural hazards*, 61(2), 757-770.
- McFeeters SK (1996) The use of the normalized difference water index (NDWI) in the delineation of open water features. *Int J Remote Sens* 17(7):1425–1432
- Moniruzzaman, M. (2012). Impact of climate change in Bangladesh: water logging at south-west coast. In *Climate change and the sustainable use of water resources* (pp. 317-336). Springer, Berlin, Heidelberg.
- Mowla, Q. A., & Islam, M. S. (2013). Natural drainage system and water logging in Dhaka: measures to address the problems. *Journal of Bangladesh Institute of Planners ISSN, 2075*, 9363.

Nabi, M.S., (2019), 36% of Dhaka's water bodies filled up in 9 years, *Bangla Tribune*

Papry, R. I., & Ahmed, G. U. (2015). Drainage Condition in Water Logged Areas of Central Part in Chittagong City Corporation. *International Journal of Engineering Science Invention* ISSN (Online, 4(1), 2319–6734.

Pirumanekul, C., & Mark, O. (2001, June). Modelling of urban flooding in Dhaka City. In *Proceedings of 4th DHI Software Conference* (pp. 101-108).

Rabbani, G., Rahman, A. A., & Islam, N. (2011). Climate change implications for Dhaka City: A need for immediate measures to reduce vulnerability. In *Resilient cities* (pp. 531-541). Springer, Dordrecht.

Rahman, M. M., Akteruzzaman, A. K. M., Khan, M. M. H., Jobber, A., & Rahman, M. M. (2009). Analysis of water logging problem and its environmental effects using GIS approaches in Khulna City of Bangladesh. *Journal of Socioeconomic Research and Development*, 6(2), 572-577.

Rahman, S., Hasan, S. M. R., Islam, M. A., & Maitra, M. K. (2011). Temporal change detection of vegetation coverage of Dhaka using Remote Sensing. *International Journal of Geomatics and Geosciences*, 2(2), 481-490.

Rashid, H., Hunt, L. M., & Haider, W. (2007). Urban flood problems in Dhaka, Bangladesh: slum residents' choices for relocation to flood-free areas. *Environmental Management*, 40(1), 95-104.

Sahu AS (2014) A study on Moyna Basin water-logged areas (India) using remote sensing and GIS methods and their contemporary economic significance.

Sar, N., Chatterjee, S., & Adhikari, M. D. (2015). Integrated remote sensing and GIS based spatial modelling through analytical hierarchy process (AHP) for water logging hazard, vulnerability and risk assessment in Keleghai river basin, India. *Modeling Earth Systems and Environment*, 1(4), 31.

Subrina, S., & Chowdhury, F. K. (2018). Urban dynamics: An undervalued issue for water logging disaster risk management in case of Dhaka city, Bangladesh. *Procedia engineering*, 212, 801-808.

Tareq, S. M., Rahman, M. T. U., Islam, A. Z., Baddruzzaman, A. B. M., & Ali, M. A. (2018). Evaluation of climate-induced water logging hazards in the south-west coast of Bangladesh using Geoinformatics. *Environmental monitoring and assessment*, 190(4), 230.

Tawhid, K. G. (2004). Causes and effects of water logging in Dhaka City, Bangladesh. *TRITA-LWR master thesis, Department of Land and Water Resource Engineering, Royal Institute of Technology, Stockholm.*

Thiele-Eich, I., Burkart, K., & Simmer, C. (2015). Trends in water level and flooding in Dhaka, Bangladesh and their impact on mortality. *International journal of environmental research and public health*, 12(2), 1196-1215.

Tucker CJ (1979) Red and photographic infrared linear combinations for monitoring vegetation. *Remote Sensing of Environment* 8, 127–150.

United Nations (2018). 2018 Revision of World Urbanization Prospects, accessible online at <https://population.un.org/wup/>

Wilson EH & Sader SA (2002) Detection of forest harvest type using multiple dates of Landsat TM imagery. *Remote Sensing of Environment* 80, 385–396.

Xue, F., Huang, M., Wang, W., & Zou, L. (2016). Numerical simulation of urban water logging based on floodarea model. *Advances in Meteorology*, 2016.

Figures

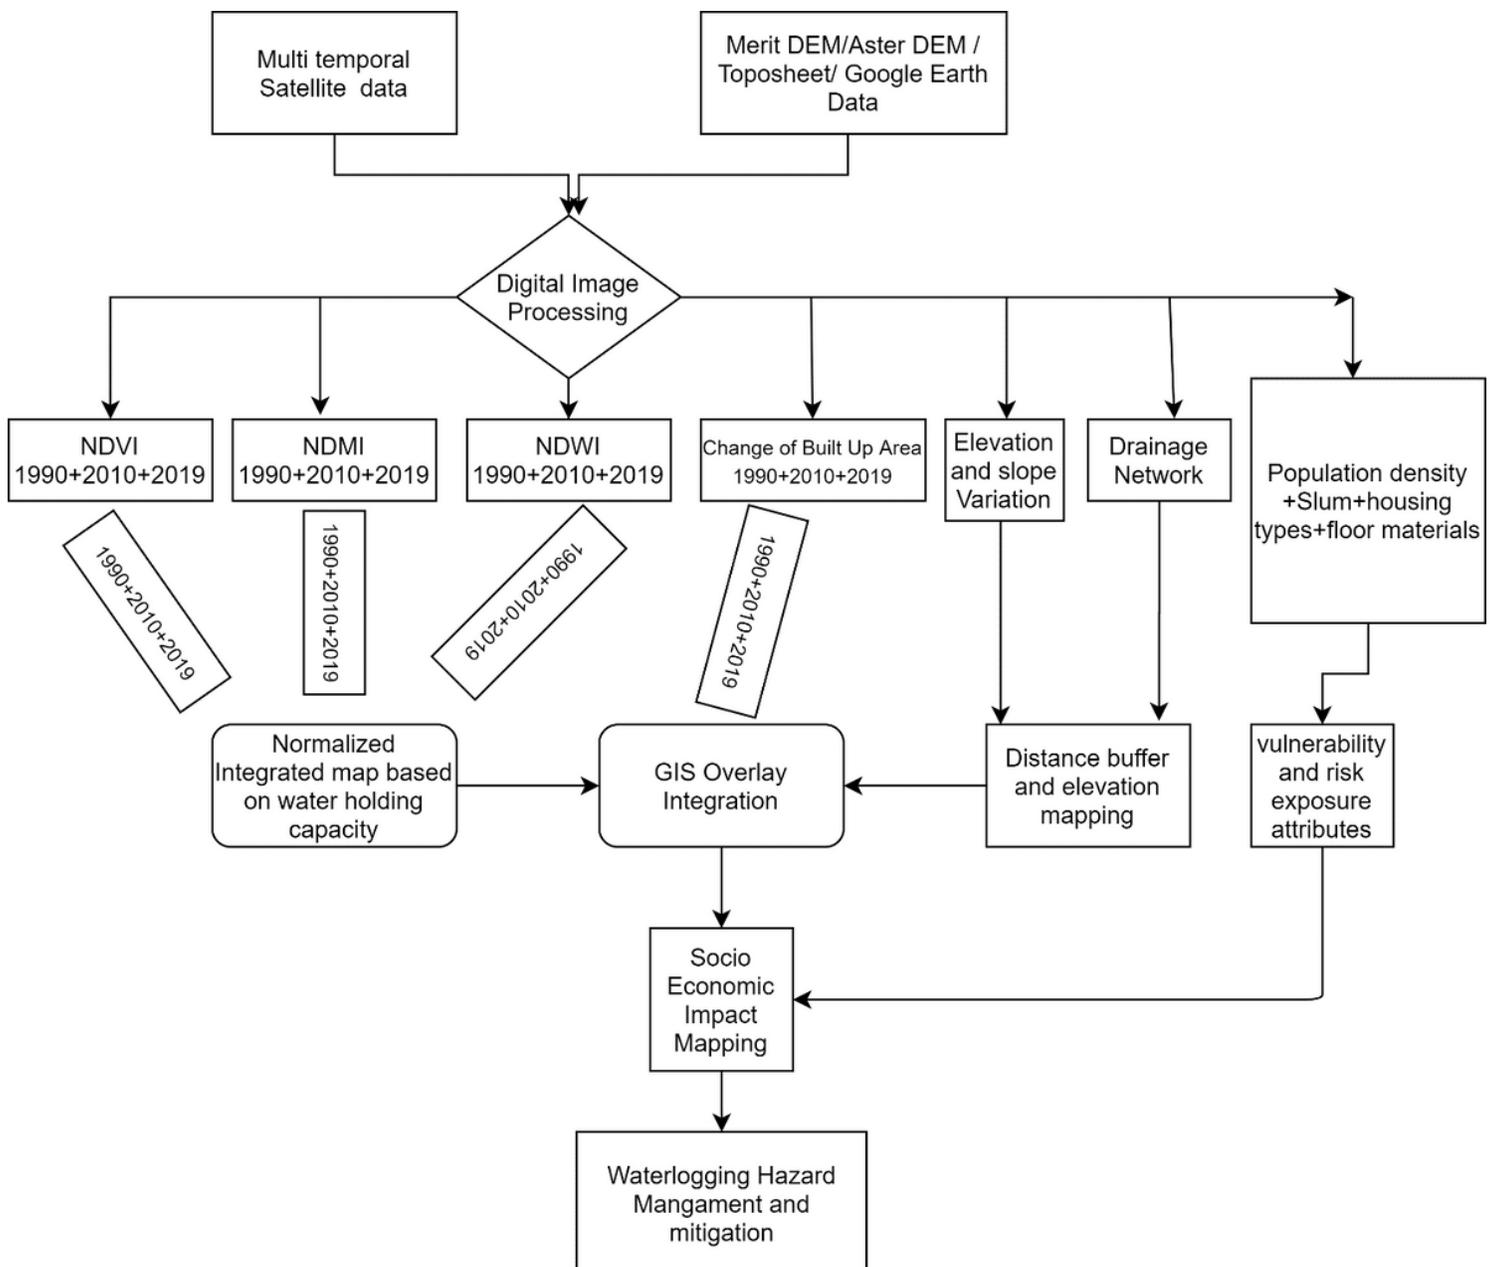


Figure 1

Flow diagram of research and data integration method

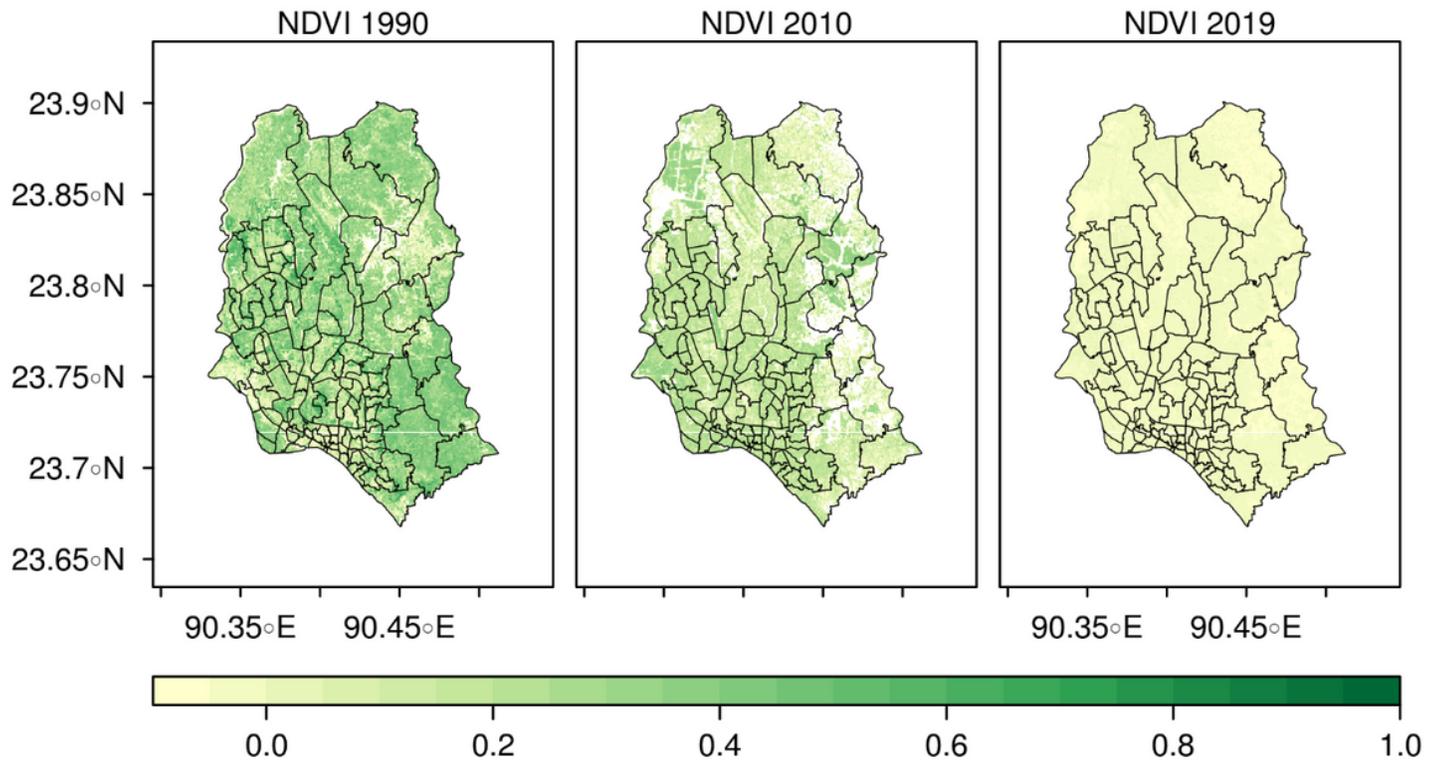


Figure 2

Temporal distribution of the NDVI map of Dhaka city in 1990, 2010 and 2019 respectively. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

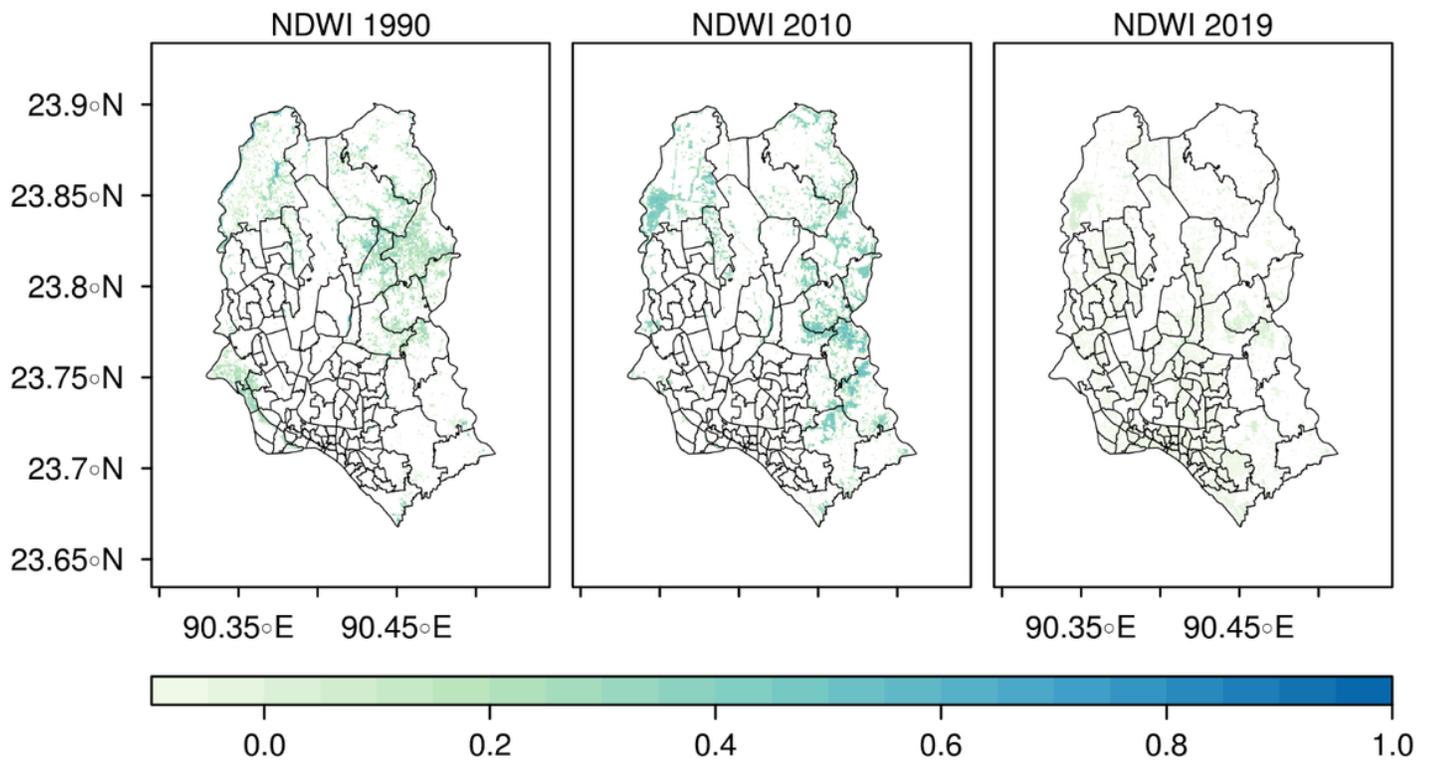


Figure 3

Temporal distribution of the NDWI map of Dhaka city in 1990, 2010 and 2019. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

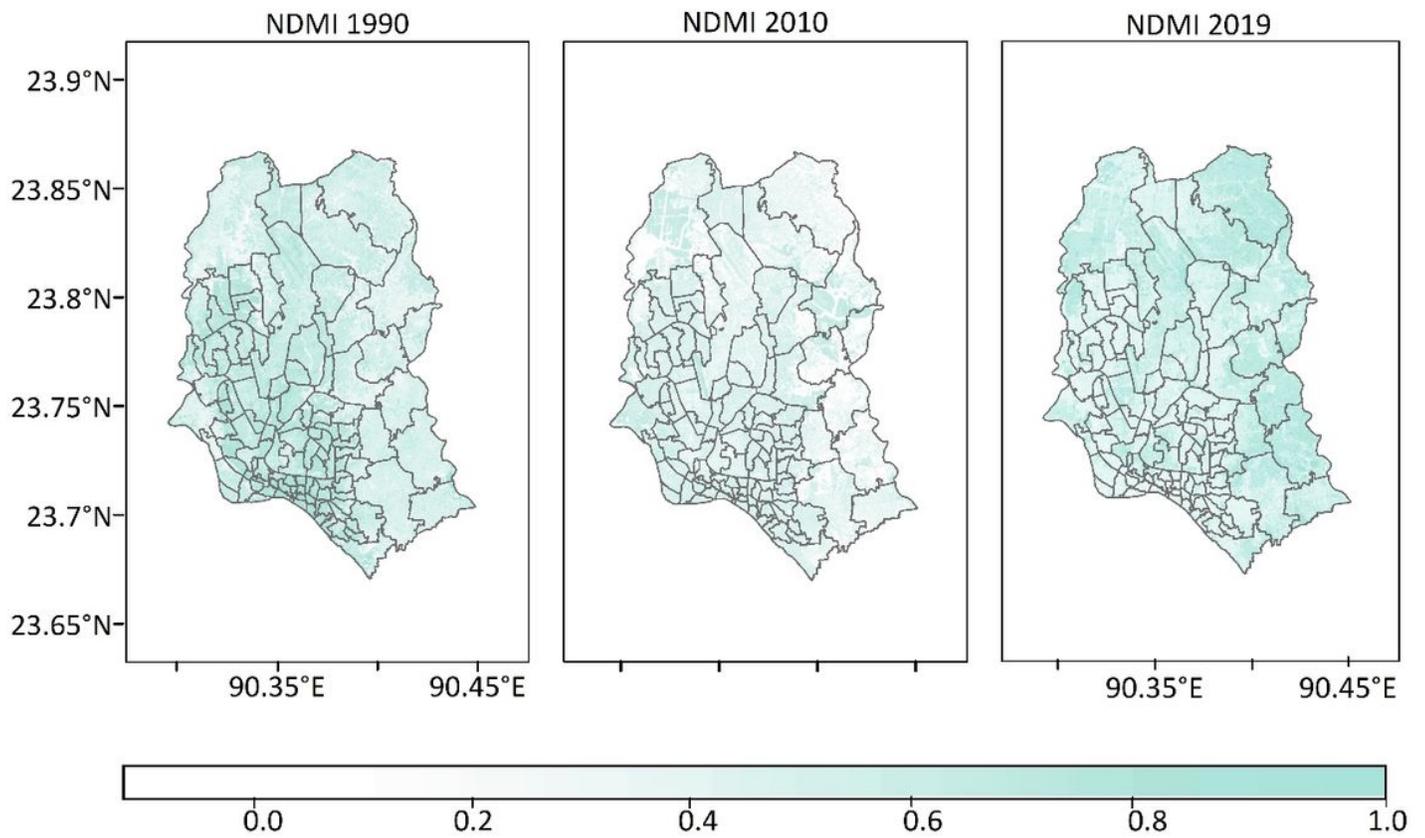


Figure 4

Temporal distribution of the NDMI map of Dhaka city in 1990, 2010 and 2019 respectively. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

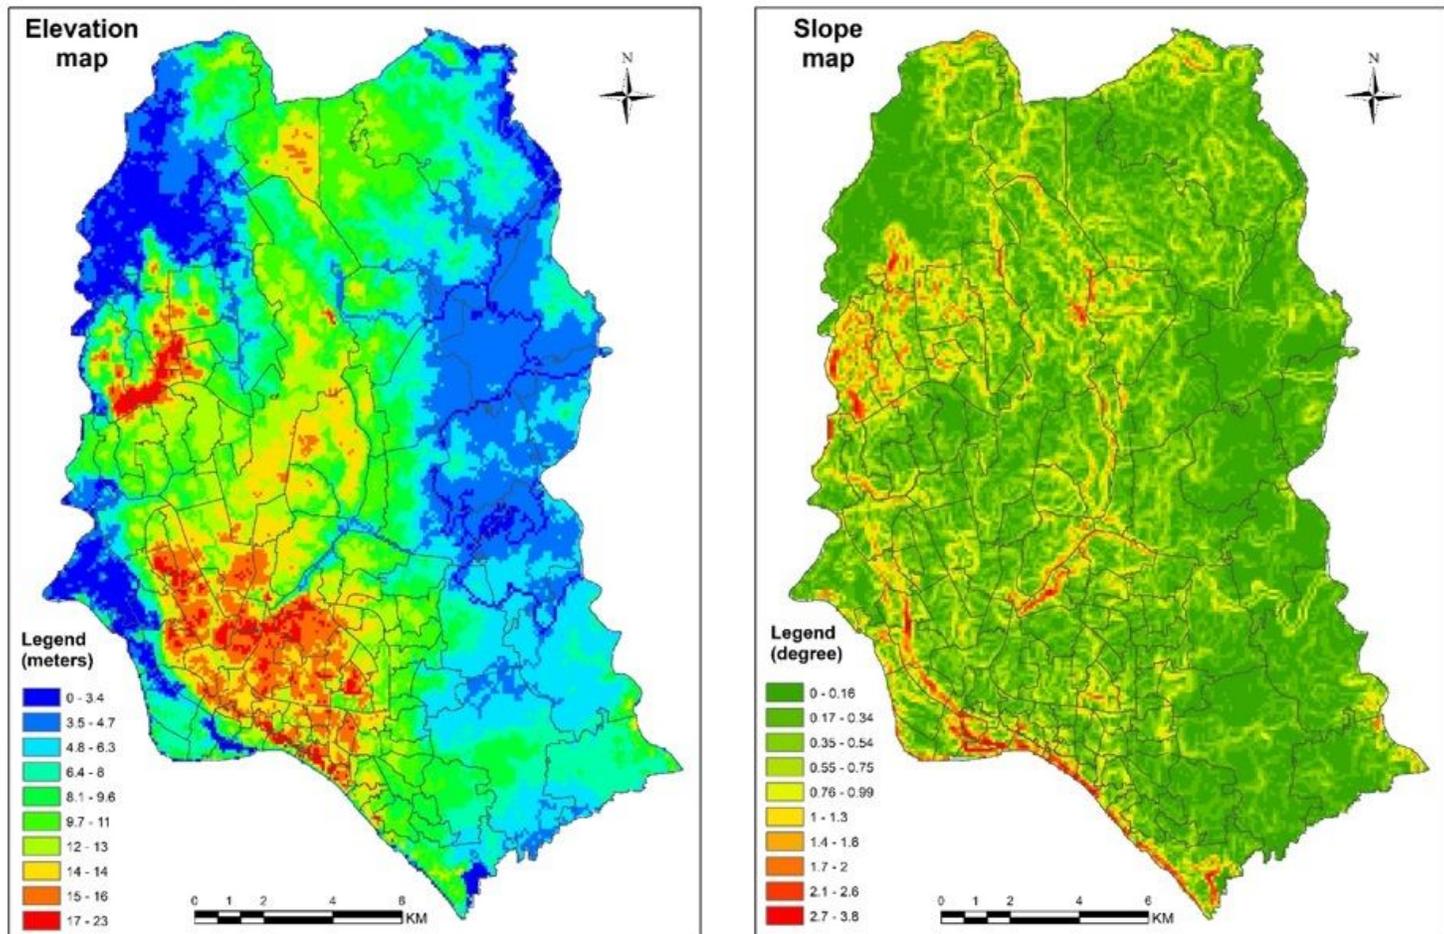


Figure 5

Elevation and slope distribution map of Dhaka city. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

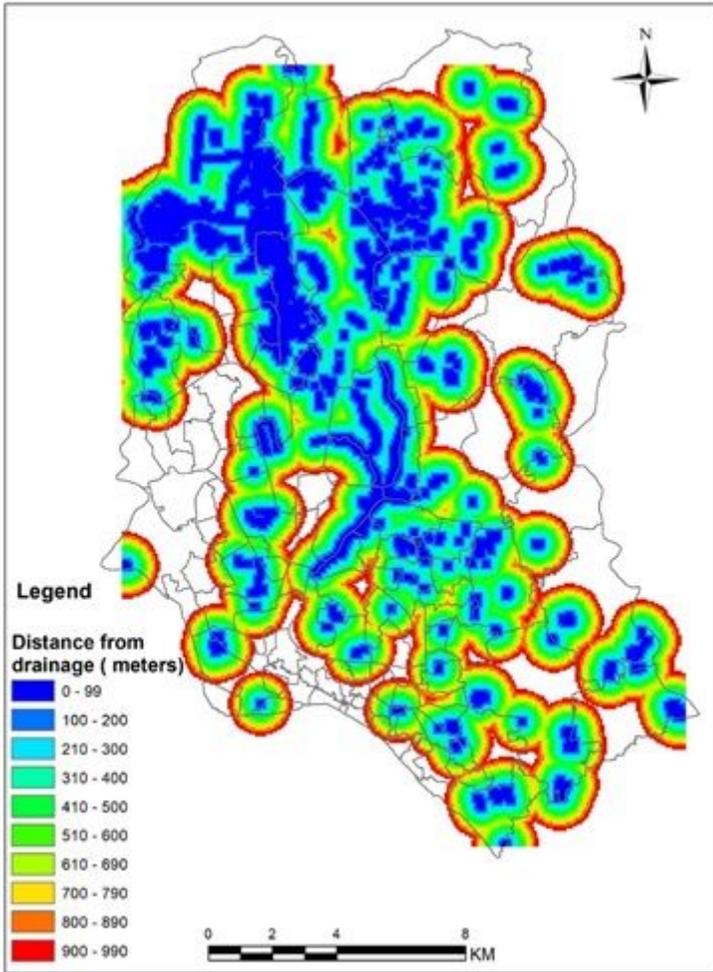


Figure 6

Distance buffer from the streams in Dhaka city. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

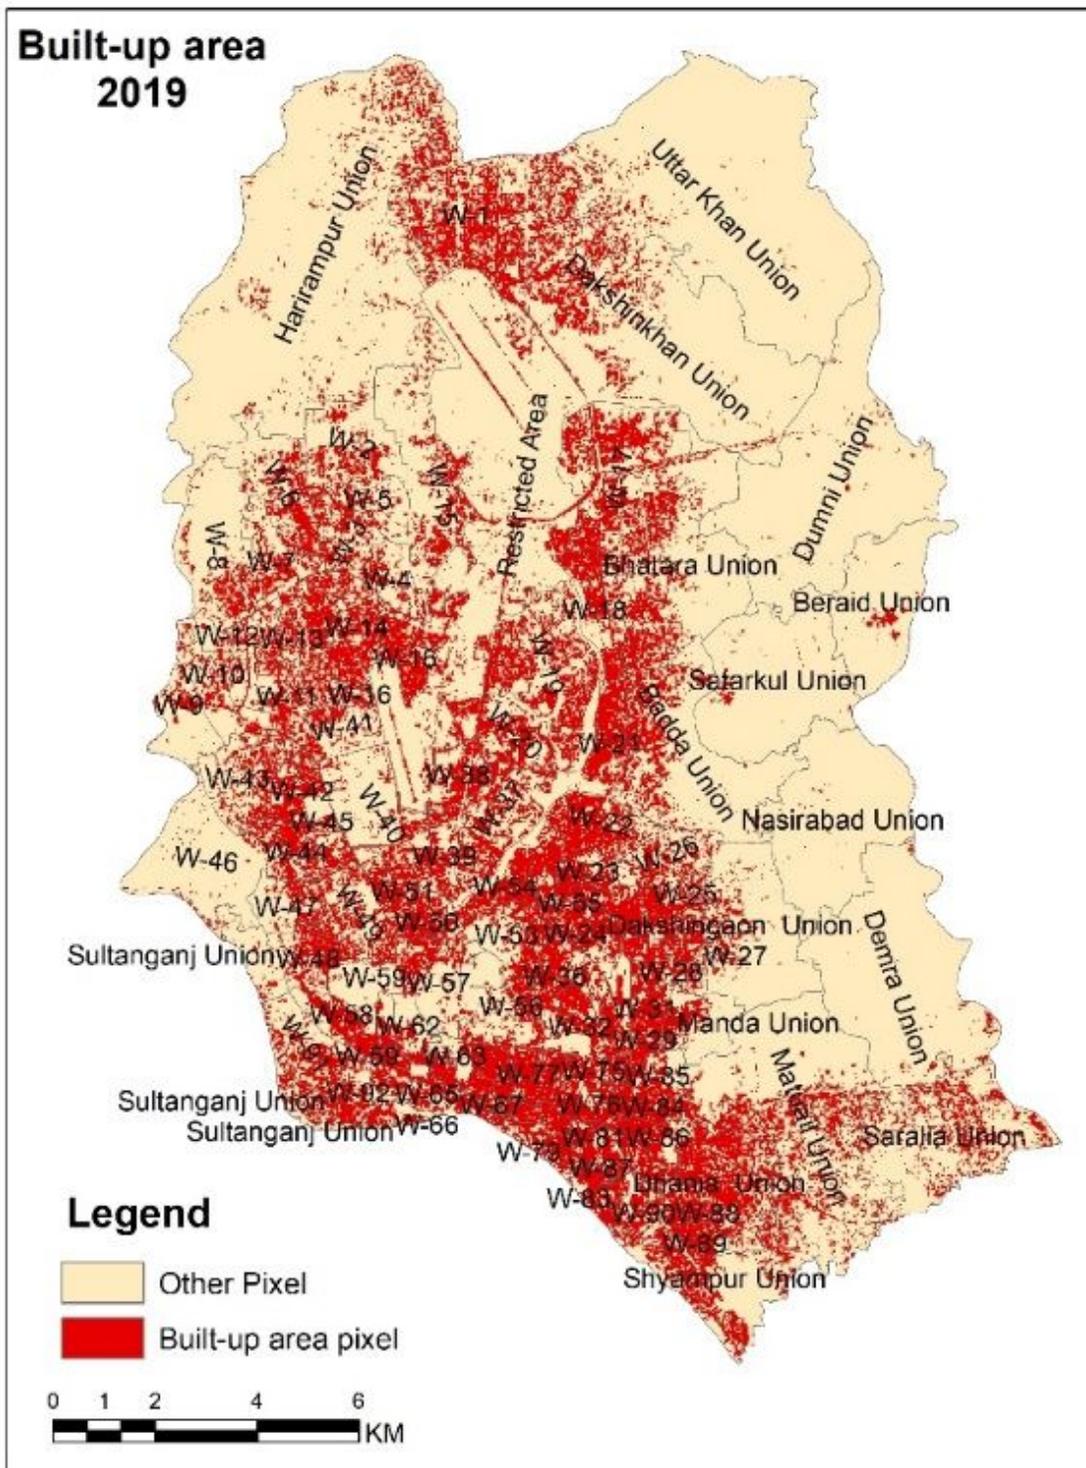


Figure 7

Built-up areas in Dhaka city in 2019. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

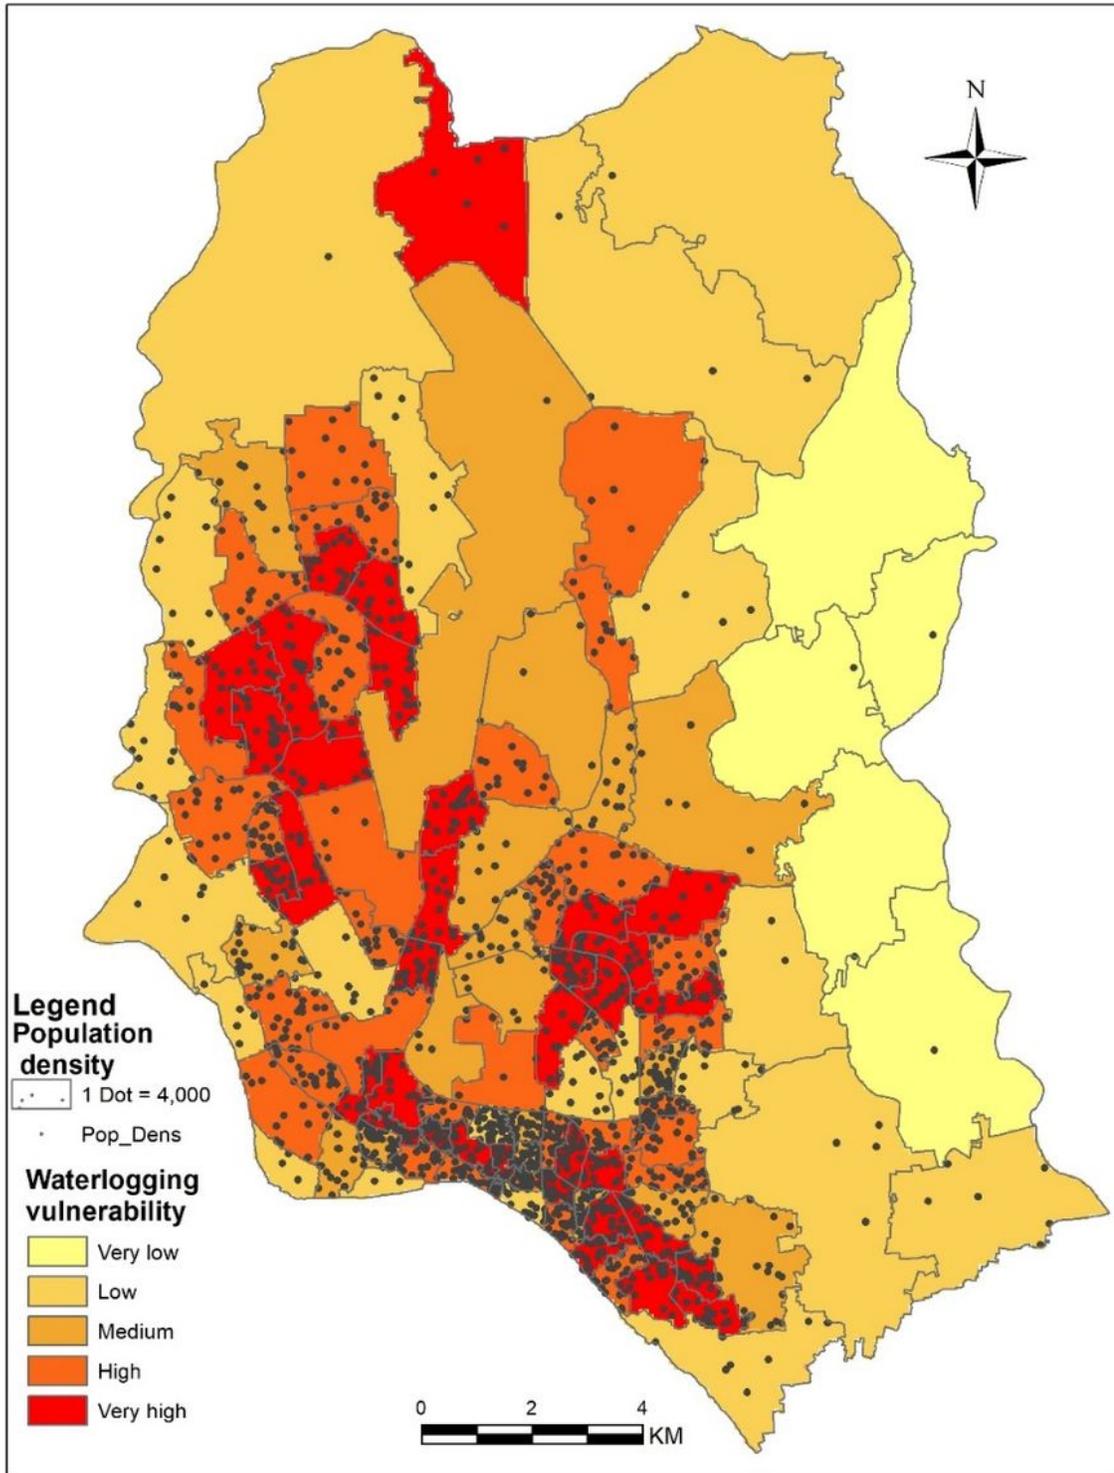


Figure 8

Water logging vulnerability zone and population density in Dhaka city. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

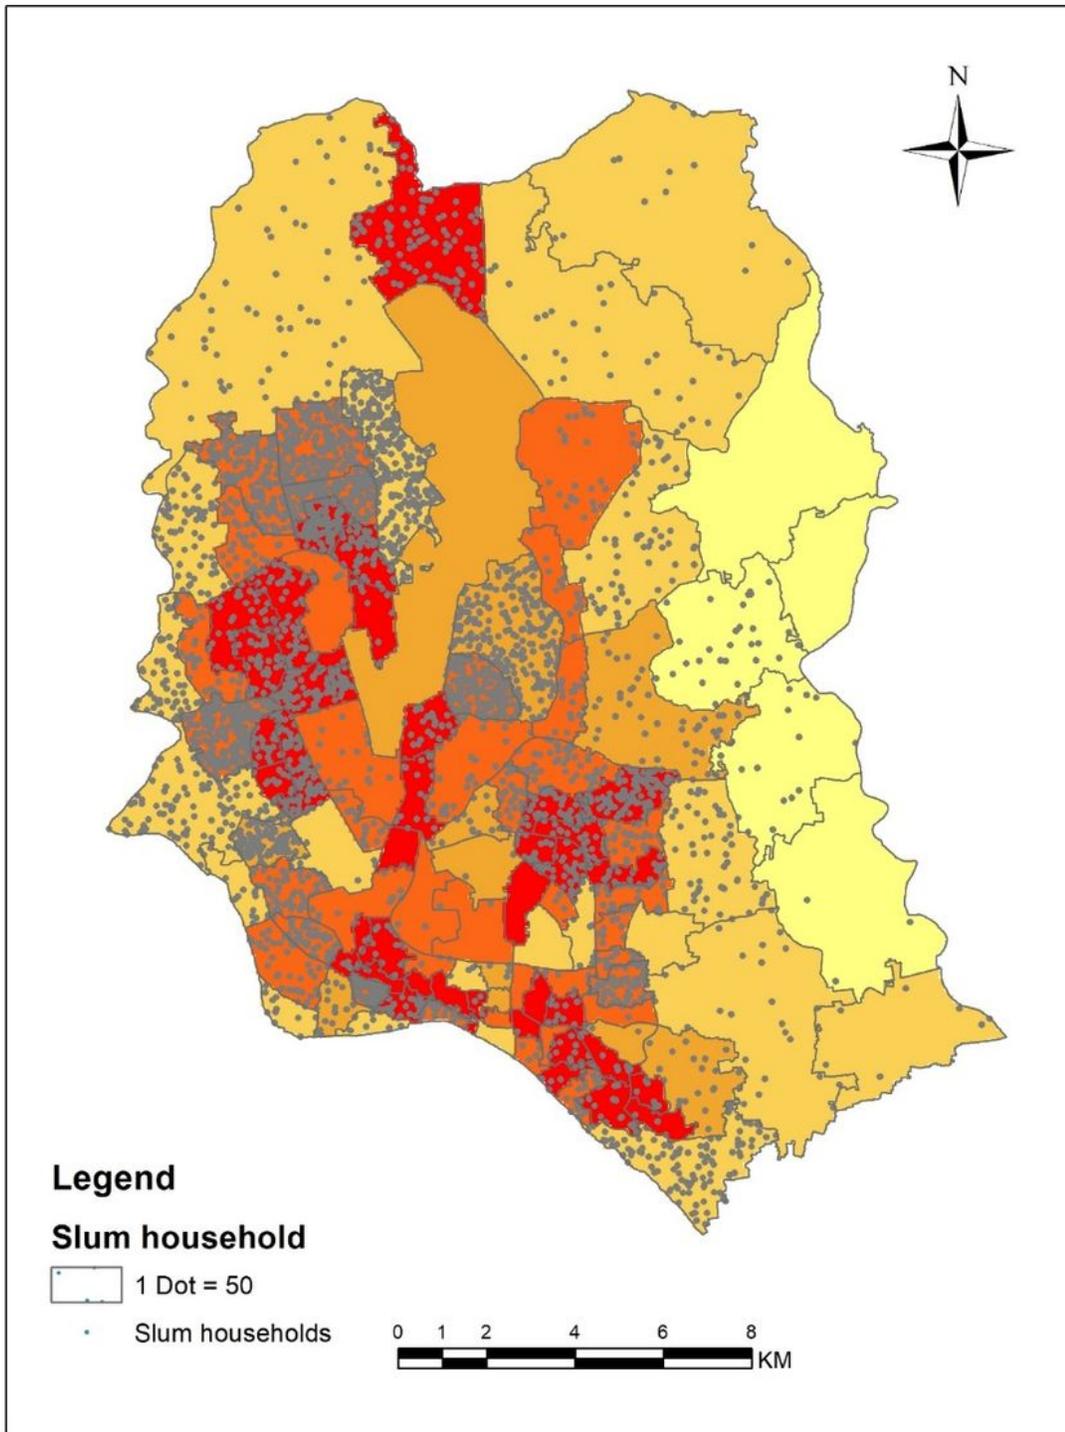


Figure 9

Water logging vulnerability zone and slum household's distribution in Dhaka city. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

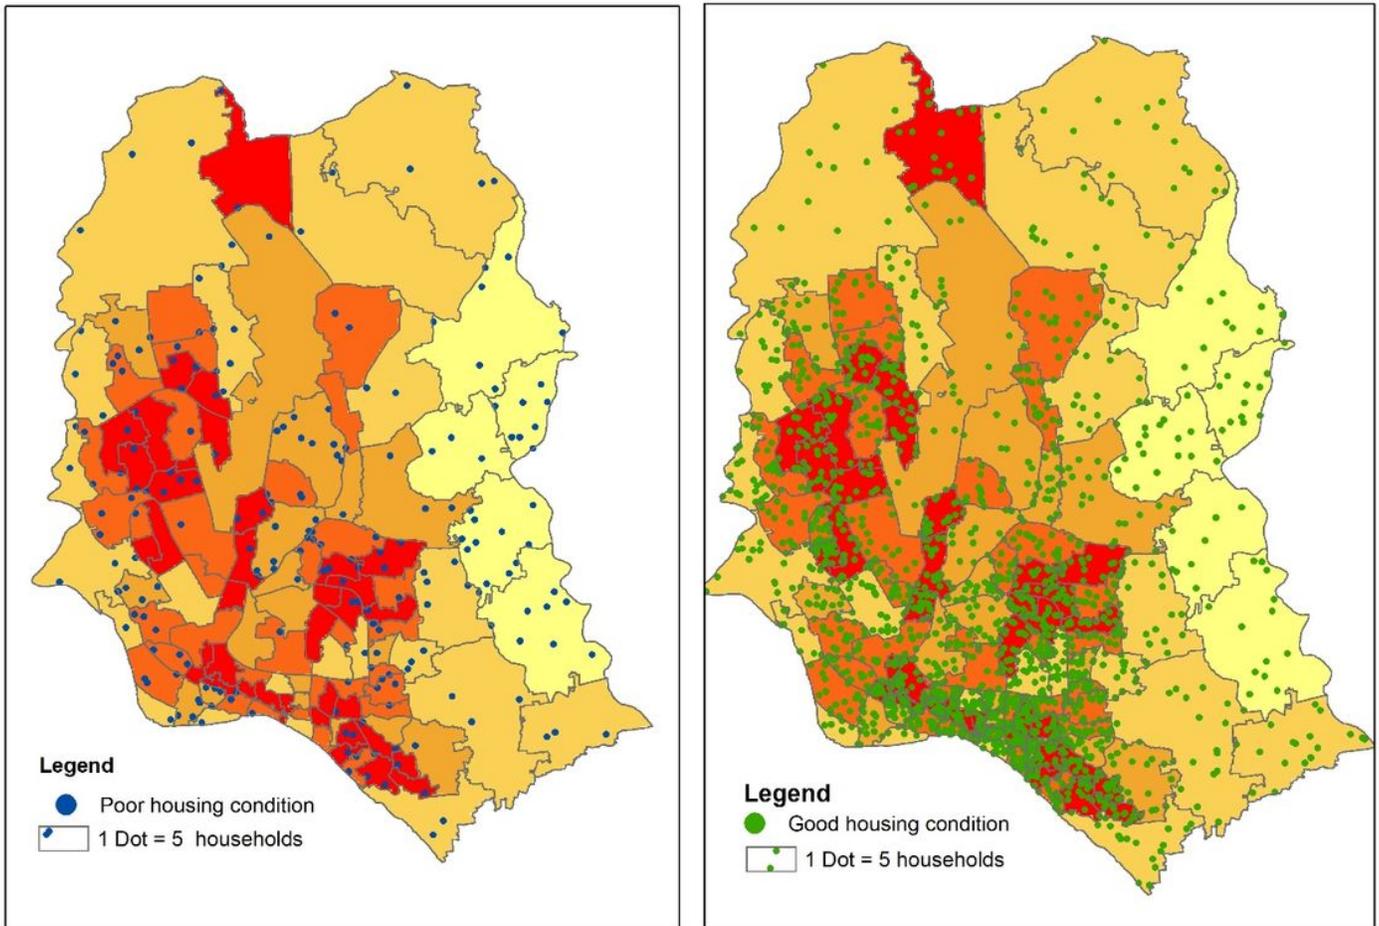


Figure 10

Water logging vulnerability zone and housing characteristics in Dhaka city. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.

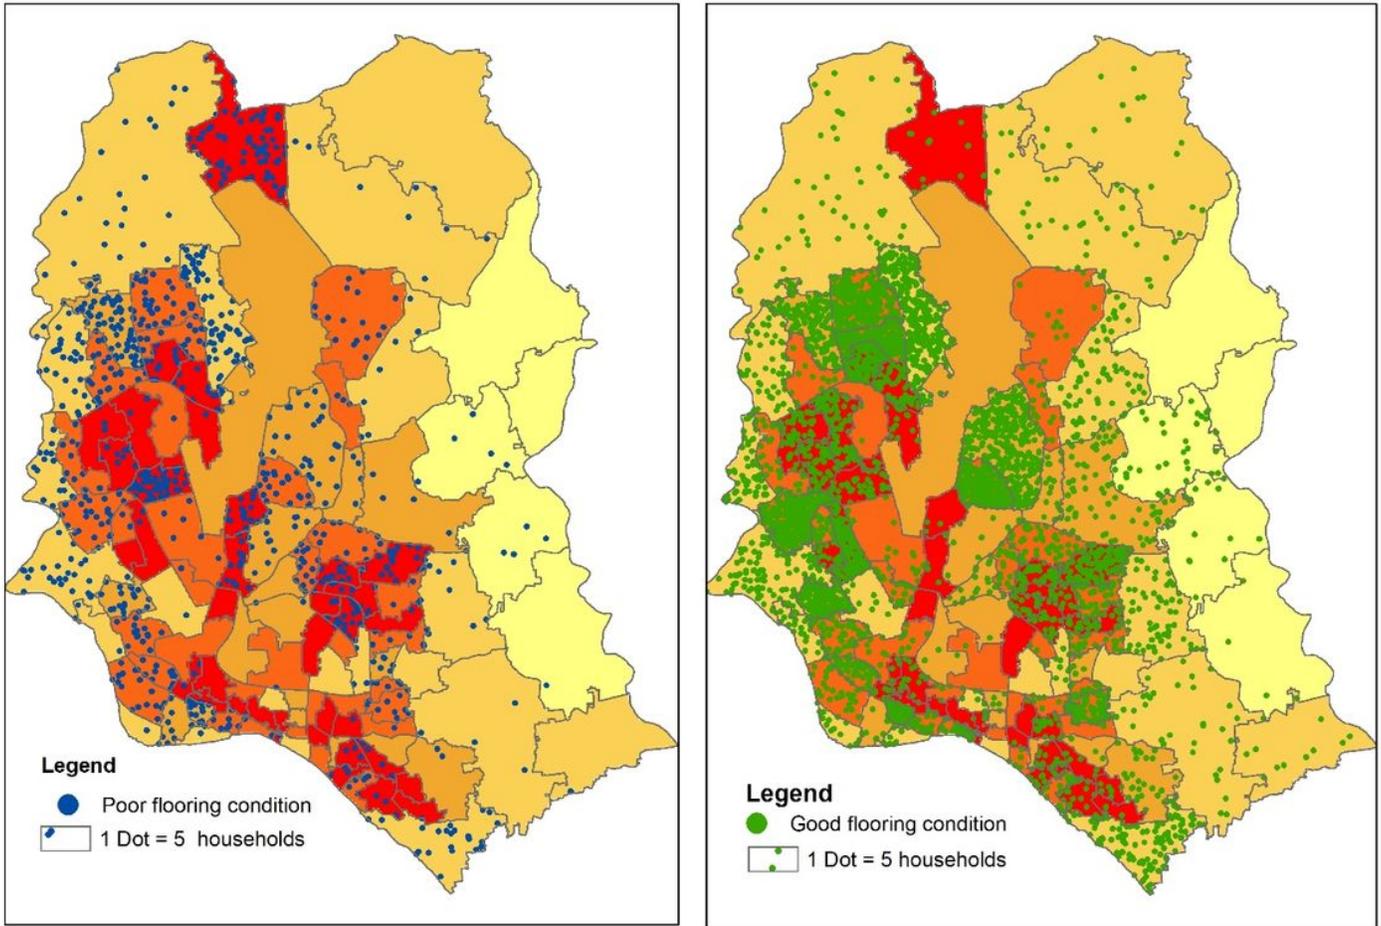


Figure 11

Water logging vulnerability zone and flooring condition in Dhaka city. Note: The designations employed and the presentation of the material on this map do not imply the expression of any opinion whatsoever on the part of Research Square concerning the legal status of any country, territory, city or area or of its authorities, or concerning the delimitation of its frontiers or boundaries. This map has been provided by the authors.